



OM-227 796A

2006-05

**Processes**



MIG (GMAW) Welding




Flux Cored (FCAW) Welding

**Description**



Semi-Automatic, Air-Cooled  
MIG (GMAW) Welding Gun

# MIGmatic<sup>TM</sup> M-25

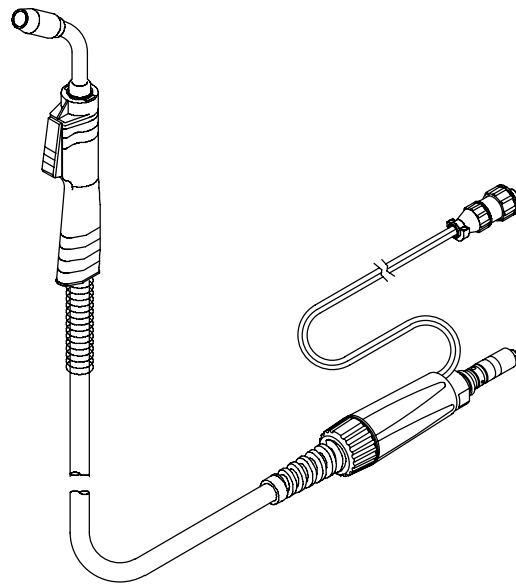

Visit our website at  
[www.MillerWelds.com](http://www.MillerWelds.com)

## OWNER'S MANUAL

File: MIG (GMAW)



# From Miller to You

---

*Thank you and congratulations* on choosing Miller. Now you can get the job done and get it done right. We know you don't have time to do it any other way.

That's why when Niels Miller first started building arc welders in 1929, he made sure his products offered long-lasting value and superior quality. Like you, his customers couldn't afford anything less. Miller products had to be more than the best they could be. They had to be the best you could buy.

Today, the people that build and sell Miller products continue the tradition. They're just as committed to providing equipment and service that meets the high standards of quality and value established in 1929.

This Owner's Manual is designed to help you get the most out of your Miller products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards on the worksite.

We've made installation and operation quick and easy. With Miller you can count on years of reliable service with proper maintenance. And if for some reason the unit needs repair, there's a Troubleshooting section that will help you figure out what the problem is. The parts list will then help you to decide the exact part you may need to fix the problem. Warranty and service information for your particular model are also provided.



Miller is the first welding equipment manufacturer in the U.S.A. to be registered to the ISO 9001:2000 Quality System Standard.

Miller Electric manufactures a full line of welders and welding related equipment. For information on other quality Miller products, contact your local Miller distributor to receive the latest full line catalog or individual specification sheets. **To locate your nearest distributor or service agency call 1-800-4-A-Miller, or visit us at [www.MillerWelds.com](http://www.MillerWelds.com) on the web.**



Working as hard as you do – every power source from Miller is backed by the most hassle-free warranty in the business.



# TABLE OF CONTENTS

---

<b>SECTION 1 – SAFETY PRECAUTIONS FOR GMAW WELDING GUNS – READ BEFORE USING</b> .....	<b>1</b>
1-1. Symbol Usage .....	1
1-2. GMAW Gun Hazards .....	1
1-3. California Proposition 65 Warnings .....	2
<b>EMF INFORMATION</b> .....	<b>2</b>
<b>SECTION 2 – SAFETY INFORMATION</b> .....	<b>3</b>
<b>SECTION 3 – INSTALLATION</b> .....	<b>3</b>
3-1. Specifications .....	3
3-2. Duty Cycle And Overheating .....	4
3-3. Installing Gun .....	4
<b>SECTION 4 – OPERATION</b> .....	<b>5</b>
4-1. Operating The Gun .....	5
<b>SECTION 5 – MAINTENANCE &amp; TROUBLESHOOTING</b> .....	<b>6</b>
5-1. Removing Nozzle, Contact Tip, And Adapter, Changing Liner, And Cleaning Gun Casing .....	6
5-2. Replacing Switch And/Or Head Tube .....	7
5-3. Routine Maintenance .....	8
5-4. Troubleshooting .....	8
<b>SECTION 6 – PARTS LIST</b> .....	<b>9</b>
<b>WARRANTY</b>	



# SECTION 1 –SAFETY PRECAUTIONS FOR GMAW WELDING GUNS – READ BEFORE USING

SR7\_8/03

## 1-1. Symbol Usage

	<p>Means Warning! Watch Out! There are possible hazards with this procedure! The possible hazards are shown in the adjoining symbols.</p>	<p>▲ Marks a special safety message.</p>
	<p>This group of symbols means Warning! Watch Out! Possible ELECTRIC SHOCK and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.</p>	
		<p>☞ Means NOTE; not safety related.</p>

## 1-2. GMAW Gun Hazards

<b>WARNING</b>	<b>GMAW WELDING can be hazardous.</b>
<p><b>PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS KEEP AWAY UNTIL CONSULTING YOUR DOCTOR.</b></p>	
<p>In welding, as in most jobs, exposure to certain hazards occurs. Welding is safe when precautions are taken. The safety information given below is only a summary of the more complete safety information found in the wire feeder and welding power source Owner's Manuals. Read and follow all safety precautions.</p>	
<p><b>HAVE ALL INSTALLATION, OPERATION, MAINTENANCE, AND REPAIR WORK PERFORMED ONLY BY QUALIFIED PEOPLE.</b></p>	

	<p><b>ELECTRIC SHOCK can kill.</b></p> <ol style="list-style-type: none"> <li>1. Always wear dry insulating gloves.</li> <li>2. Insulate yourself from work and ground.</li> <li>3. Do not touch live electrode or electrical parts.</li> <li>4. Repair or replace worn, damaged, or cracked gun or cable insulation.</li> <li>5. Turn off welding power source before changing contact tip or gun parts.</li> <li>6. Keep all covers and handle securely in place.</li> </ol>		<p><b>ARC RAYS can burn eyes and skin.</b></p> <ol style="list-style-type: none"> <li>1. Wear welding helmet with correct shade of filter.</li> <li>2. Wear correct eye and body protection.</li> <li>3. Cover exposed skin with spatter-resistant clothing.</li> </ol>
	<p><b>FUMES AND GASES can be hazardous to your health.</b></p> <ol style="list-style-type: none"> <li>1. Keep your head out of the fumes.</li> <li>2. Ventilate area, or use breathing device.</li> <li>3. Read Material Safety Data Sheets (MSDSs) and manufacturer's instructions for material used.</li> </ol>		<p><b>HOT SURFACES can burn skin.</b></p> <ol style="list-style-type: none"> <li>1. Allow gun to cool before touching.</li> <li>2. Do not touch hot metal.</li> <li>3. Protect hot metal from contact by others.</li> </ol>
	<p><b>WELDING can cause fire or explosion.</b></p> <ol style="list-style-type: none"> <li>1. Do not weld near flammable material.</li> <li>2. Do not weld on closed containers.</li> <li>3. Watch for fire; keep extinguisher nearby.</li> </ol>		<p><b>NOISE can damage hearing; SOME APPLICATIONS, SUCH AS PULSING, are noisy.</b></p> <ol style="list-style-type: none"> <li>1. Check for noise level limits exceeding those specified by OSHA.</li> <li>2. Use approved ear plugs or ear muffs if noise level is high.</li> <li>3. Warn others nearby about noise hazard.</li> </ol>
	<p><b>BUILD UP OF GAS can injure or kill</b></p> <ol style="list-style-type: none"> <li>1. Shut off shielding gas supply when not in use.</li> <li>2. Always ventilate confined spaces or use approved air-supplied respirator.</li> </ol>		<p><b>WELDING WIRE can cause puncture wounds.</b></p> <ol style="list-style-type: none"> <li>1. Keep hands and body away from gun tip when trigger is pressed.</li> </ol>

## 1-3. California Proposition 65 Warnings

- ▲ Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Section 25249.5 et seq.)
- ▲ Battery posts, terminals and related accessories contain lead and lead compounds, chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. Wash hands after handling.

### For Gasoline Engines:

- ▲ Engine exhaust contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

### For Diesel Engines:

- ▲ Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.

## EMF INFORMATION

### NOTE



### *Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields*

The following is a quotation from the General Conclusions Section of the U.S. Congress, Office of Technology Assessment, *Biological Effects of Power Frequency Electric & Magnetic Fields – Background Paper*, OTA-BP-E-53 (Washington, DC: U.S. Government Printing Office, May 1989): “. . . there is now a very large volume of scientific findings based on experiments at the cellular level and from studies with animals and people which clearly establish that low frequency magnetic fields can interact with, and produce changes in, biological systems. While most of this work is of very high quality, the results are complex. Current scientific understanding does not yet allow us to interpret the evidence in a single coherent framework. Even more frustrating, it does not yet allow us to draw definite conclusions about questions of possible risk or to offer clear science-based advice on strategies to minimize or avoid potential risks.”

To reduce magnetic fields in the workplace, use the following procedures:


1. Keep cables close together by twisting or taping them.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around the body.
4. Keep welding power source and cables as far away as practical.
5. Connect work clamp to workpiece as close to the weld as possible.

### **About Pacemakers:**

The above procedures are among those also normally recommended for pacemaker wearers. Consult your doctor for complete information.

mod10.1 4/93

# SECTION 2 – SAFETY INFORMATION

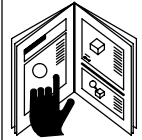

- Read all safety messages throughout this manual.
- Obey all safety messages to avoid injury.
- Learn the meaning of WARNING and CAUTION.

1 → **WARNING**

2 → **ELECTRIC SHOCK can kill.**

3 → Do not touch live electrical parts.  
Disconnect input power before installing or servicing.

4 →

5 →

2 → **CAUTION**

**MOVING PARTS can injure.**

• Keep away from moving parts.  
• Keep all panels and covers closed when operating.


6 → **WARNING** **READ SAFETY BLOCKS at start of Section 3-1 before proceeding.**

7 → **NOTE** *Turn Off switch when using high frequency.*



- 1 Safety Alert Symbol
  - 2 Signal Word
- WARNING means possible death or serious injury can happen.  
CAUTION means possible minor injury or equipment damage can happen.
- 3 Statement Of Hazard And Result
  - 4 Safety Instructions To Avoid Hazard
  - 5 Hazard Symbol (If Available)
  - 6 Safety Banner
- Read safety blocks for each symbol shown.
- 7 NOTE  
Special instructions for best operation – not related to safety.

# SECTION 3 – INSTALLATION
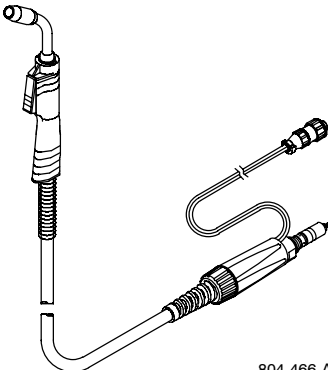
## 3-1. Specifications








 <p>804 466-A</p>	<p>Air-Cooled Welding Gun For GMAW And FCAW Welding</p> <p><b>Note:</b> Using gasless flux cored wire reduces gun duty cycle.</p>
	<p>M-25 Feeds .023 To .045 in (0.6 To 1.1 mm) Hard Or Flux Cored Wires</p> <p>Duty Cycle Rating:            100%: 250 A With CO<sub>2</sub> Shielding Gas; 150 A With Mixed Gases            60%: 300 A With CO<sub>2</sub> Shielding Gas; 250 A With Mixed Gases</p> <p>Weight With 15 ft (4.6 m) Power Cable: 6.0 lb (2.7 kg)</p> <p>Identified With <span style="display: inline-block; width: 10px; height: 10px; background-color: black; margin-right: 5px;"></span> <span style="display: inline-block; width: 10px; height: 10px; background-color: black; margin-right: 5px;"></span> <span style="display: inline-block; width: 10px; height: 10px; border: 1px solid black; margin-right: 5px;"></span> On Power Cable</p>

### 3-2. Duty Cycle And Overheating





☞ See Section 3-1. Specifications for amperage rating and duty cycle.

▲ Exceeding duty cycle can damage unit and void warranty.




<p><b>Definition</b></p>  <p>10 Minutes</p> <p>Duty Cycle is percentage of 10 minutes that gun can weld at rated load without overheating.</p>	<p><b>.023 To .045 in (0.6 To 1.1 mm) Hard Or Flux Cored Wires</b></p> <p>100% Duty Cycle At 200 Amperes Using CO<sub>2</sub></p> <p>100% Duty Cycle At 150 Amperes Using Mixed Gases</p>   <p style="text-align: center;">Continuous Welding</p>	<p><b>.023 To .045 in (0.6 To 1.1 mm) Hard Or Flux Cored Wires</b></p> <p>60% Duty Cycle At 300 Amperes Using CO<sub>2</sub></p> <p>60% Duty Cycle At 200 Amperes Using Mixed Gases</p>   <p style="text-align: center;">6 Minutes Welding</p> <p style="text-align: center;">→</p>   <p style="text-align: center;">4 Minutes Resting</p>
---	---	---

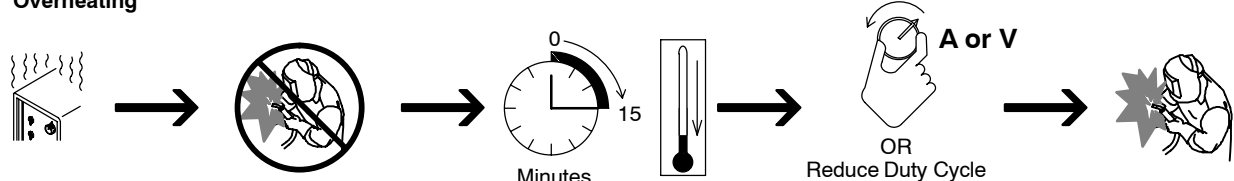
**Overheating**



sduty1 5/95

### 3-3. Installing Gun

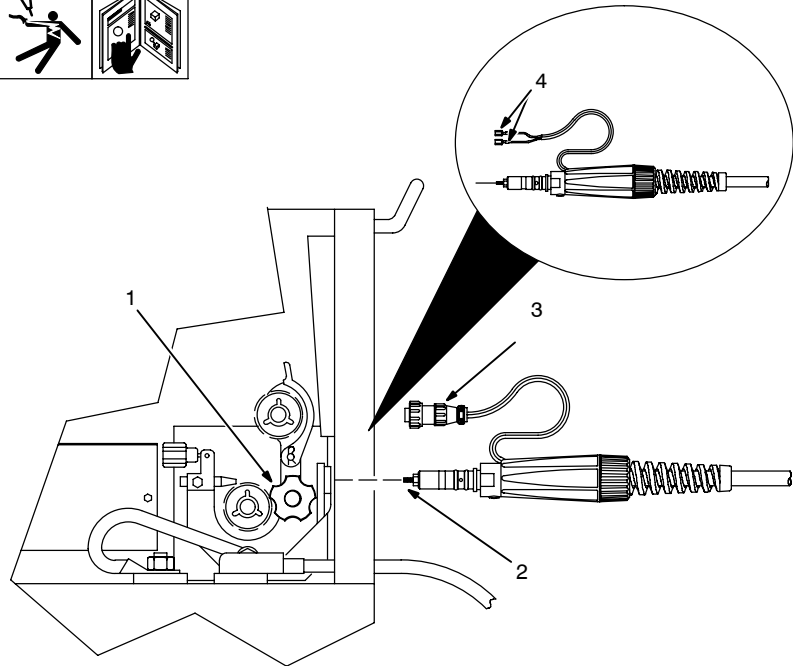

- 1 Gun Securing Knob
- 2 Gun End
- 3 Gun Trigger Plug
- 4 Friction Terminals

Loosen knob. Insert gun end until it bottoms against drive assembly. Tighten knob.

Insert into receptacle, and tighten threaded collar.

Some applications will require cutting off trigger plug and installing 0.250 female friction terminals onto end of leads.


See wire feeder manual for threading procedure.

804 465-A



# SECTION 4 – OPERATION

## 4-1. Operating The Gun

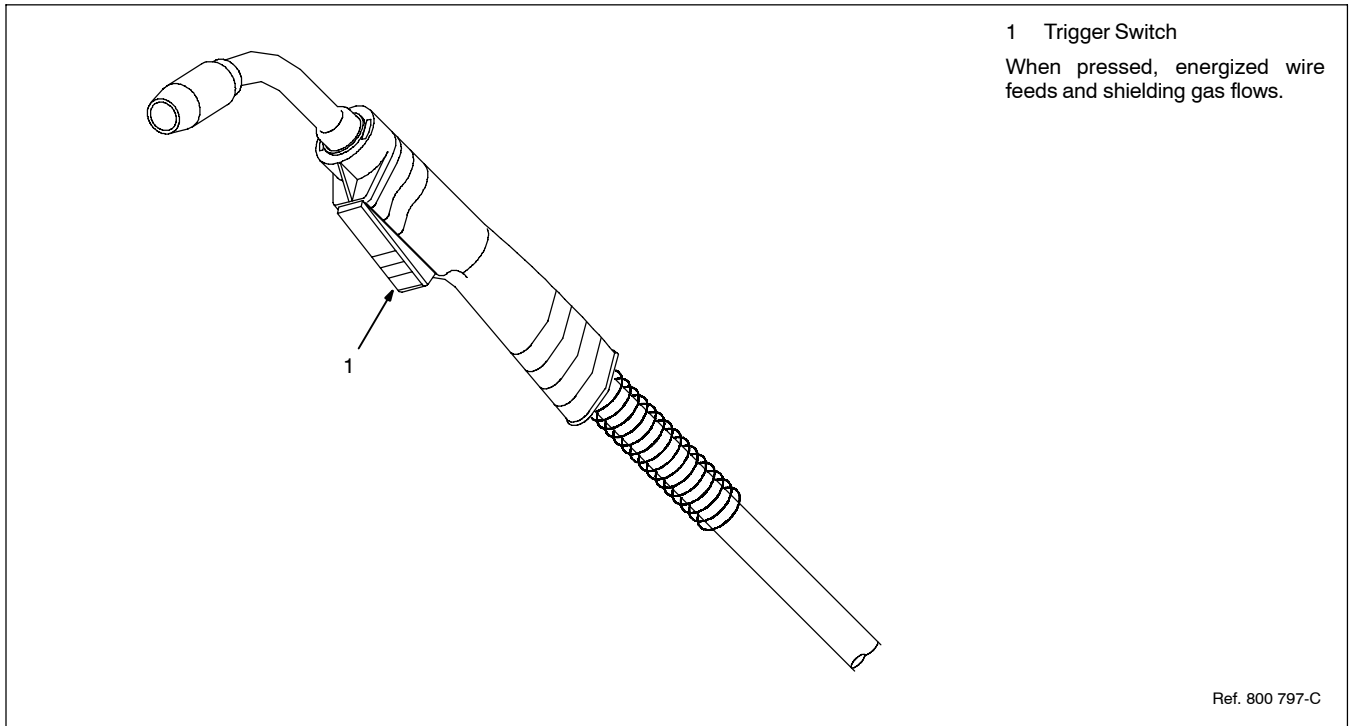

# SECTION 5 – MAINTENANCE & TROUBLESHOOTING

## 5-1. Removing Nozzle, Contact Tip, And Adapter, Changing Liner, And Cleaning Gun Casing

**▲ Turn off welding power source/wire feeder.**

- 1 Nozzle
- 2 Contact Tip
- 3 Tip Adapter
- 4 Nozzle Adapter

**☞ Wire size stamped on tip – check and match wire size.**

Remove nozzle, contact tip, and adapter.

Cut off wire and disconnect gun from feeder.

Blow out gun casing.

Lay gun cable out straight before installing new liner.

Unscrew and remove liner.

Reassemble gun in reverse order from taking it apart.

Install Liner

**☞ Thread wire according to welding power source/wire feeder manual.**

 
  

**Tools Needed:**

5/8, 7/16 in


3/4 in (20 mm)  
Liner Stickout

## 5-2. Replacing Switch And/Or Head Tube




▲ Turn Off welding power source /wire feeder and disconnect gun.

1 Remove handle locking nut.

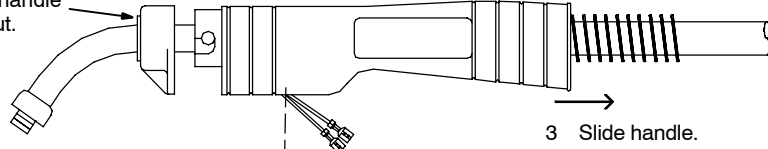


3 Slide handle.

 2 Remove switch housing. Install new switch and connect leads (polarity is not important). Reassemble in reverse order. If replacing head tube, continue to end of figure.




4 Secure head tube in vice.

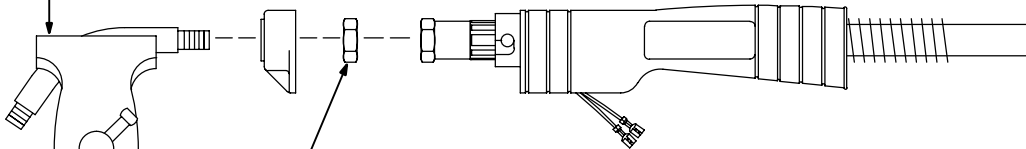


5 Loosen jam nut. Remove from vice and turn head tube out by hand.


6 Install existing shock washer onto new head tube. Hand-tighten head tube into cable connector.

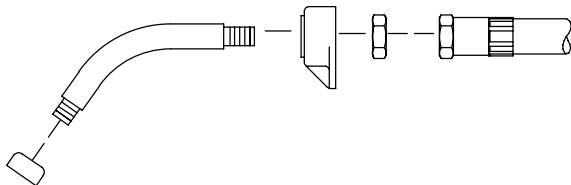

7 Place head tube in vice and tighten until nuts are tight.

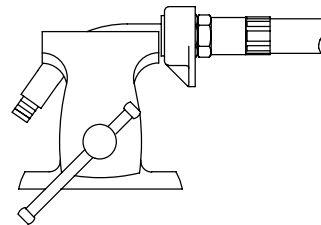


8 Remove from vice. Reposition handle and install switch housing. Secure with handle locking nut.

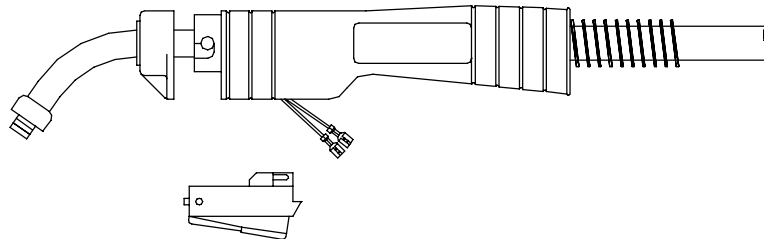

Tools Needed:

 
 
 

 
 



3/4 in




Ref. 800 795-D


### 5-3. Routine Maintenance

 	<p>▲ Turn Off welding power source and disconnect gun before maintaining.</p>
<b>Each Spool Of Wire</b>	
 <p>Blow Out Gun Casing</p>	 <p>Clean Nozzle And Check Contact Tip</p>
<p> <b>3 Months</b></p>	
 <p>Replace Cracked Parts</p>	 <p>Control Cord</p>
 <p>Gas Hose</p>	

### 5-4. Troubleshooting

	
Trouble	Remedy
Wire does not feed; wire is not energized; wire feeds unevenly.	Check contact tip. Check for kinks in gun cable.
	Check gun trigger plug connection at welding power source/wire feeder.
	Check, and if necessary, replace gun trigger switch (see Section 5-2).
	Check contact tip. Check for kinks in gun cable. Blow out liner and gun casing (see Section 5-1).
Weld porosity.	Remove weld spatter buildup in nozzle.
	Make sure inner head tube is tight in cable connector.
	Check shielding gas flow/supply.
Wire feeding stops or does not feed properly during welding.	Straighten gun cable and/or replace damaged parts (see Section 5-1).
	Adjust drive roll pressure (see wire feeder manual).
	Change to proper drive roll groove (see wire feeder manual).
	Readjust hub tension (see wire feeder manual).
	Clean or replace liner if dirty or plugged (see Section 5-1).
	Replace drive roll or pressure bearing if worn or slipping (see wire feeder manual).

# SECTION 6 – PARTS LIST

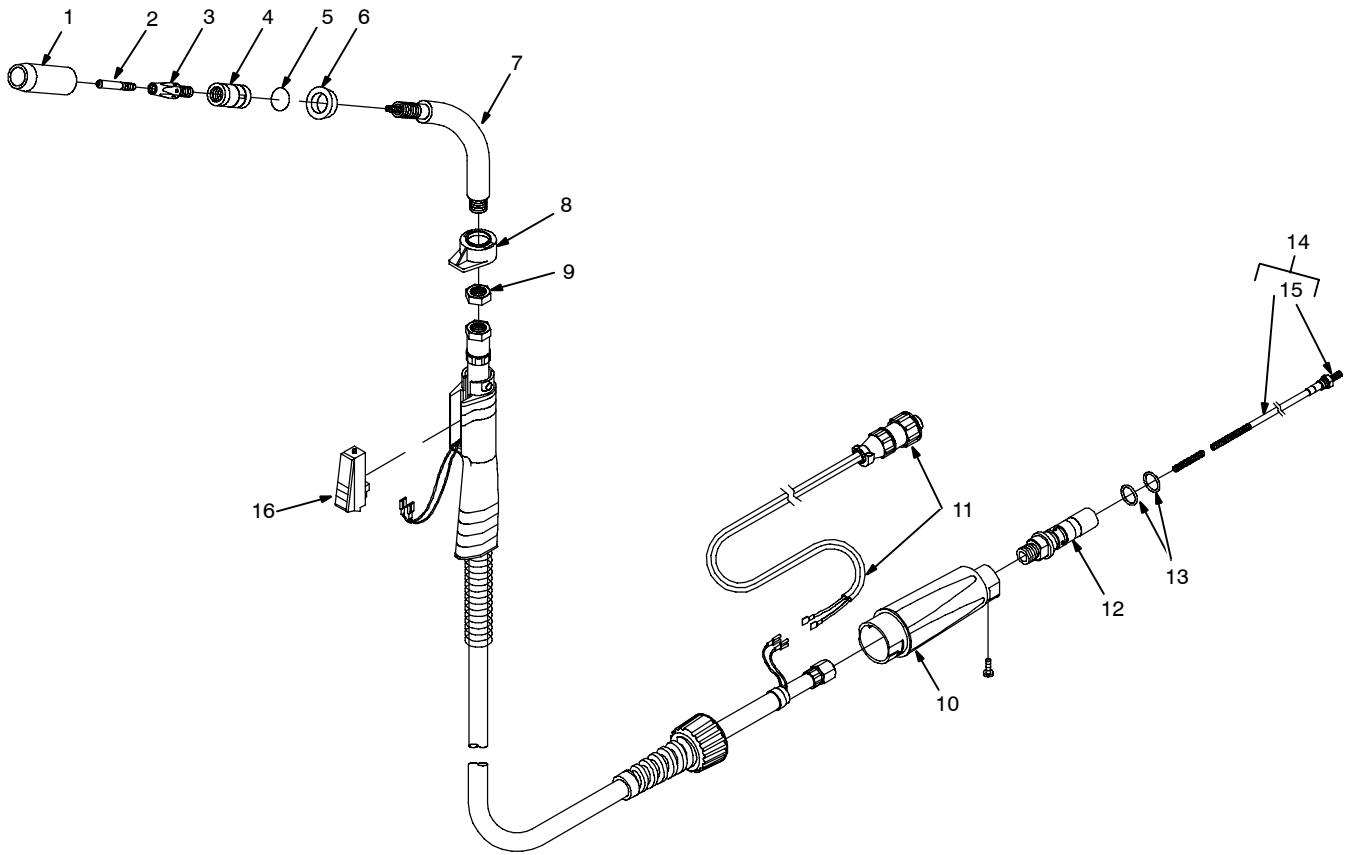

804 467-A

**Figure 6-1. M-25 Gun**

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------

**Figure 6-1. M-25 Gun**

... 1	.....	200 258	.. NOZZLE, slip type .500 orf flush .....	1
... 1	.....	+169 724	.. NOZZLE, slip type .500 orf .125 recess .....	1
... 1	.....	+169 725	.. NOZZLE, slip type .625 orf .125 recess .....	1
... 1	.....	+169 726	.. NOZZLE, slip type .625 orf flush .....	1
... 1	.....	+169 727	.. NOZZLE, slip type .625 orf .125 stickout .....	1
... 2	.....	+087 299	.. TIP, contact scr .023 wire x 1.125 .....	
... 2	.....	+000 067	.. TIP, contact scr .030 wire x 1.125 .....	
... 2	.....	+000 068	.. TIP, contact scr .035 wire x 1.125 .....	
... 2	.....	+000 069	.. TIP, contact scr .045 wire x 1.125 .....	
... 3	.....	169 728	.. ADAPTER, contact tip .....	1
... 4	.....	169 729	.. ADAPTER, nozzle w/retaining ring .....	1
... 5	.....	170 468	.. O-RING .....	1
... 6	.....	169 730	.. WASHER, shock .....	1
... 7	.....	169 731	.. TUBE, head .....	1

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
----------	------------	----------	-------------	----------

**Figure 6-1. M-25 Gun (Continued)**

... 8	...	169 738	.. NUT, locking handle	1
... 9	...	169 732	.. NUT, jam	1
... 10	...	227 799	.. HANDLE, rear	1
... 11	...	227 800	.. CORD, trigger assembly	1
... 12	...	209 495	.. CONNECTOR, feeder	1
... 13	...	079 974	.. O-RING, .500 ID x .103CS rbr	2
... 14	...	+194 010	.. LINER, monocoil .023/.025 wire x 15ft (consisting of)	1
... 14	...	194 011	.. LINER, monocoil .030/.035 wire x 15ft (consisting of)	1
... 14	...	+194 012	.. LINER, monocoil .035/.045 wire x 15ft (consisting of)	1
... 14	...	+194 014	.. LINER, monocoil 3/64 AL wire x 10ft (consisting of)	1
... 15	...	079 975	.. O-RING, .187 ID x .103CS rbr	1
... 16	...	227 798	.. SWITCH, trigger	1

**+OPTIONAL**

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model is required when ordering parts from your local distributor.**

# TRUE BLUE<sup>®</sup>

## WARRANTY

Effective January 1, 2006

(Equipment with a serial number preface of "LG" or newer)

This limited warranty supersedes all previous Miller warranties and is exclusive with no other guarantees or warranties expressed or implied.

### Warranty Questions?

Call  
1-800-4-A-MILLER  
for your local  
Miller distributor.

Your distributor also gives  
you ...

#### Service

You always get the fast,  
reliable response you  
need. Most replacement  
parts can be in your  
hands in 24 hours.

#### Support

Need fast answers to the  
tough welding questions?  
Contact your distributor.  
The expertise of the  
distributor and Miller is  
there to help you, every  
step of the way.

LIMITED WARRANTY – Subject to the terms and conditions below, Miller Electric Mfg. Co., Appleton, Wisconsin, warrants to its original retail purchaser that new Miller equipment sold after the effective date of this limited warranty is free of defects in material and workmanship at the time it is shipped by Miller. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

Within the warranty periods listed below, Miller will repair or replace any warranted parts or components that fail due to such defects in material or workmanship. Miller must be notified in writing within thirty (30) days of such defect or failure, at which time Miller will provide instructions on the warranty claim procedures to be followed.

Miller shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the date that the equipment was delivered to the original retail purchaser, or one year after the equipment is sent to a North American distributor or eighteen months after the equipment is sent to an International distributor.

1. 5 Years Parts — 3 Years Labor
  - \* Original main power rectifiers
2. 3 Years — Parts and Labor
  - \* Transformer/Rectifier Power Sources
  - \* Plasma Arc Cutting Power Sources
  - \* Process Controllers
  - \* Semi-Automatic and Automatic Wire Feeders
  - \* Inverter Power Sources (Unless Otherwise Stated)
  - \* Water Coolant Systems (Integrated)
  - \* Intellitig
  - \* Engine Driven Welding Generators  
**(NOTE: Engines are warranted separately by the engine manufacturer.)**
3. 1 Year — Parts and Labor Unless Specified
  - \* Motor Driven Guns (w/exception of Spoolmate Spoolguns)
  - \* Positioners and Controllers
  - \* Automatic Motion Devices
  - \* RFCS Foot Controls
  - \* Induction Heating Power Sources, Coolers, and Electronic Controls/Recorders
  - \* Water Coolant Systems (Non-Integrated)
  - \* Flowgauge and Flowmeter Regulators (No Labor)
  - \* HF Units
  - \* Grids
  - \* Spot Welders
  - \* Load Banks
  - \* Arc Stud Power Sources & Arc Stud Guns
  - \* Racks
  - \* Running Gear/Trailers
  - \* Plasma Cutting Torches (except APT & SAF Models)
  - \* Field Options  
(NOTE: Field options are covered under True Blue<sup>®</sup> for the remaining warranty period of the product they are installed in, or for a minimum of one year — whichever is greater.)
  - \* Bernard-Branded Mig Guns (No Labor)
  - \* Weldcraft-Branded TIG Torches (No Labor)
  - \* Subarc Wire Drive Assemblies
4. 6 Months — Batteries
5. 90 Days — Parts
  - \* MIG Guns/TIG Torches and Subarc (SAW) Guns

- \* Induction Heating Coils and Blankets, Cables, and Non-Electronic Controls
- \* APT & SAF Model Plasma Cutting Torches
- \* Remote Controls
- \* Accessory (Kits)
- \* Replacement Parts (No labor)
- \* Spoolmate Spoolguns
- \* Canvas Covers

Miller's True Blue<sup>®</sup> Limited Warranty shall not apply to:

1. **Consumable components; such as contact tips, cutting nozzles, contactors, brushes, slip rings, relays or parts that fail due to normal wear. (Exception: brushes, slip rings, and relays are covered on Bobcat, Trailblazer, and Legend models.)**
2. Items furnished by Miller, but manufactured by others, such as engines or trade accessories. These items are covered by the manufacturer's warranty, if any.
3. Equipment that has been modified by any party other than Miller, or equipment that has been improperly installed, improperly operated or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of the specifications for the equipment.

MILLER PRODUCTS ARE INTENDED FOR PURCHASE AND USE BY COMMERCIAL/INDUSTRIAL USERS AND PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT.

In the event of a warranty claim covered by this warranty, the exclusive remedies shall be, at Miller's option: (1) repair; or (2) replacement; or, where authorized in writing by Miller in appropriate cases, (3) the reasonable cost of repair or replacement at an authorized Miller service station; or (4) payment of or credit for the purchase price (less reasonable depreciation based upon actual use) upon return of the goods at customer's risk and expense. Miller's option of repair or replacement will be F.O.B., Factory at Appleton, Wisconsin, or F.O.B. at a Miller authorized service facility as determined by Miller. Therefore no compensation or reimbursement for transportation costs of any kind will be allowed.

TO THE EXTENT PERMITTED BY LAW, THE REMEDIES PROVIDED HEREIN ARE THE SOLE AND EXCLUSIVE REMEDIES. IN NO EVENT SHALL MILLER BE LIABLE FOR DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES (INCLUDING LOSS OF PROFIT), WHETHER BASED ON CONTRACT, TORT OR ANY OTHER LEGAL THEORY.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTY OR REPRESENTATION AS TO PERFORMANCE, AND ANY REMEDY FOR BREACH OF CONTRACT TORT OR ANY OTHER LEGAL THEORY WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY MILLER IS EXCLUDED AND DISCLAIMED BY MILLER.

Some states in the U.S.A. do not allow limitations of how long an implied warranty lasts, or the exclusion of incidental, indirect, special or consequential damages, so the above limitation or exclusion may not apply to you. This warranty provides specific legal rights, and other rights may be available, but may vary from state to state.

In Canada, legislation in some provinces provides for certain additional warranties or remedies other than as stated herein, and to the extent that they may not be waived, the limitations and exclusions set out above may not apply. This Limited Warranty provides specific legal rights, and other rights may be available, but may vary from province to province.

miller\_warr 2006-01





# Owner's Record

Please complete and retain with your personal records.

Model Name

Serial/Style Number

Purchase Date

(Date which equipment was delivered to original customer.)

Distributor

Address

City

State

Zip



## For Service

**Contact a DISTRIBUTOR or SERVICE AGENCY near you.**

Always provide Model Name and Serial/Style Number.

Contact your Distributor for:

Welding Supplies and Consumables

Options and Accessories

Personal Safety Equipment

Service and Repair

Replacement Parts

Training (Schools, Videos, Books)

Technical Manuals (Servicing Information and Parts)

Circuit Diagrams

Welding Process Handbooks

To locate a Distributor or Service Agency visit [www.millerwelds.com](http://www.millerwelds.com) or call 1-800-4-A-Miller

Contact the Delivering Carrier to:

File a claim for loss or damage during shipment.

For assistance in filing or settling claims, contact your distributor and/or equipment manufacturer's Transportation Department.

### Miller Electric Mfg. Co.

An Illinois Tool Works Company  
1635 West Spencer Street  
Appleton, WI 54914 USA

### International Headquarters—USA

USA Phone: 920-735-4505 Auto-Attended  
USA & Canada FAX: 920-735-4134  
International FAX: 920-735-4125

### European Headquarters – United Kingdom

Phone: 44 (0) 1204-593493  
FAX: 44 (0) 1204-598066

[www.MillerWelds.com](http://www.MillerWelds.com)





## Free Manuals Download Website

<http://myh66.com>

<http://usermanuals.us>

<http://www.somanuals.com>

<http://www.4manuals.cc>

<http://www.manual-lib.com>

<http://www.404manual.com>

<http://www.luxmanual.com>

<http://aubethermostatmanual.com>

Golf course search by state

<http://golfingnear.com>

Email search by domain

<http://emailbydomain.com>

Auto manuals search

<http://auto.somanuals.com>

TV manuals search

<http://tv.somanuals.com>