



Errata to MPC750 RISC Microprocessor User's Manual

This errata describes corrections to the *MPC750 RISC Microprocessor User's Manual*. These corrections also apply to the MPC740, which is described in *MPC750 RISC Microprocessor User's Manual*. For convenience, the section number and page number of the errata item in the user's manual are provided.

To locate any published updates for this document, refer to the world-wide web at <http://www.mot.com/powerpc>.

Section/Page	Changes
2.1.1, 2-7	The implementation note for the decrementer register (DEC) should read as follows: In the MPC750 the decrementer register is decremented and the time base is incremented at a speed that is one-fourth the speed of the bus clock.
2.1.2.2, 2-12	In Table 2-4, replace the description of HIDO[DBP] (bit 1), with the following:

This document contains information on a new product under development by Motorola and IBM. Motorola and IBM reserve the right to change or discontinue this product without notice.

© Motorola Inc., 1999. All rights reserved.



1	DBP	Disable 60x bus address and data parity generation. 0 The system generates address and data parity. 1 Parity generation is disabled and parity signals are driven to 0 during bus operations. When parity generation is disabled, all parity checking should also be disabled and parity signals need not be connected.
---	-----	---

Replace the description of HID0[BTIC] (bit 26), with the following:

26	BTIC	BTIC enable. Used to enable use of the 64-entry branch instruction cache. 0 The BTIC contents are invalidated and the BTIC behaves as if it were empty. New entries cannot be added until the BTIC is enabled. 1 The BTIC is enabled and new entries can be added.
----	------	--

2.1.2.4.5, 2-18

Replace Table 2-11 with the following:

Table 2-11. PMC2 Events—MMCR0[26–31] Select Encodings

Encoding	Description
00 0000	Register holds current value.
00 0001	Counts processor cycles.
00 0010	Counts completed instructions. Does not include folded branches.
00 0011	Counts transitions from 0 to 1 of TBL bits specified through MMRC0[RTCSELECT]. 00 = 47, 01 = 51, 10 = 55, 11 = 63.
00 0100	Counts instructions dispatched. 0, 1, or 2 instructions per cycle.
00 0101	Counts L1 instruction cache misses.
00 0110	Counts ITLB misses.
00 0111	Counts L2 instruction misses.
00 1000	Counts branches predicted or resolved not taken.
00 1001	Counts MSR[PR] bit toggles.
00 1010	Counts times reserved load operations completed.
00 1011	Counts completed load and store instructions.
00 1100	Counts snoops to the L1 and the L2.
00 1101	Counts L1 cast-outs to the L2.
00 1110	Counts completed system unit instructions.
00 1111	Counts instruction fetch misses in the L1.
01 0000	Counts branches allowing out-of-order execution that resolved correctly.
All others	Reserved.

4.5.11, 4-20

Remove Table 4-10, “Trace Exception—SRR1 Settings.” This interrupt is implemented as defined by the OEA. Remove the Table 4-10 and the introductory text.

5.1.7, 5-18

Table 5-4, delete the second row in table (**lwarx** or **stwcx**, with $W = 1$).

7.2.5.2.1, 7-14

For **ARTRY**, change “Timing Comments,” “Negation,” first paragraph, last sentence to the following:

First the buffer goes to high impedance for a minimum of one-half processor cycle (dependent on the clock mode), then it is driven negated for one-half bus cycle before returning to high impedance.

9.1.2, 9-5

In Table 9-1, replace the description of **L2CR[L2DO]** (bit 9), with the following:

9	L2DO	L2 data-only. Setting this bit inhibits the caching of instructions in the L2 cache. All accesses from the L1 instruction cache are treated as cache-inhibited by the L2 cache (bypass L2 cache, no L2 tag look-up performed).
---	------	--

11.2.1.5, 11-7

Replace Table 11-6 with the following:

Table 11-16. PMC2 Events—MMCR0[26–31] Select Encodings

Encoding	Description
00 0000	Register holds current value.
00 0001	Counts processor cycles.
00 0010	Counts completed instructions. Does not include folded branches.
00 0011	Counts transitions from 0 to 1 of TBL bits specified through MMCR0[RTCSELECT] . 00 = 47, 01 = 51, 10 = 55, 11 = 63.
00 0100	Counts instructions dispatched. 0, 1, or 2 instructions per cycle.
00 0101	Counts L1 instruction cache misses.
00 0110	Counts ITLB misses.
00 0111	Counts L2 instruction misses.
00 1000	Counts branches predicted or resolved not taken.
00 1001	Counts MSR[PR] bit toggles.
00 1010	Counts times reserved load operations completed.
00 1011	Counts completed load and store instructions.
00 1100	Counts snoops to the L1 and the L2.
00 1101	Counts L1 cast-outs to the L2.
00 1110	Counts completed system unit instructions.
00 1111	Counts instruction fetch misses in the L1.
01 0000	Counts branches allowing out-of-order execution that resolved correctly.
All others	Reserved.

The PowerPC name is a registered trademark and the PowerPC logotype is a trademark of International Business Machines Corporation used by Motorola under license from International Business Machines Corporation.

Mfax is a trademark of Motorola, Inc.

Information in this document is provided solely to enable system and software implementers to use PowerPC microprocessors. There are no express or implied copyright licenses granted hereunder to design or fabricate PowerPC integrated circuits or integrated circuits based on the information in this document.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters can and do vary in different applications. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part.

Motorola and  are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

Motorola Literature Distribution Centers:

USA/EUROPE: Motorola Literature Distribution; P.O. Box 5405; Denver, Colorado 80217; Tel.: 1-800-441-2447 or 1-303-675-2140;

World Wide Web Address: <http://ldc.nmd.com/>

JAPAN: Nippon Motorola Ltd SPD, Strategic Planning Office 4-32-1, Nishi-Gotanda Shinagawa-ku, Tokyo 141, Japan Tel.: 81-3-5487-8488

ASIA/PACIFIC: Motorola Semiconductors H.K. Ltd Silicon Harbour Centre 2, Dai King Street Tai Po Industrial Estate Tai Po, New Territories, Hong Kong

Mfax™: RMFAX0@email.sps.mot.com; TOUCHTONE 1-602-244-6609; US & Canada ONLY (800) 774-1848;

World Wide Web Address: <http://sps.motorola.com/mfax>

INTERNET: <http://motorola.com/sps>

Technical Information: Motorola Inc. SPS Customer Support Center; 1-800-521-6274; electronic mail address: crc@wmkmail.sps.mot.com.

Document Comments: FAX (512) 895-2638, Attn: RISC Applications Engineering.

World Wide Web Addresses: <http://www.mot.com/PowerPC>
<http://www.mot.com/netcomm>

MPC750UMAD/AD



Free Manuals Download Website

<http://myh66.com>

<http://usermanuals.us>

<http://www.somanuals.com>

<http://www.4manuals.cc>

<http://www.manual-lib.com>

<http://www.404manual.com>

<http://www.luxmanual.com>

<http://aubethermostatmanual.com>

Golf course search by state

<http://golfingnear.com>

Email search by domain

<http://emailbydomain.com>

Auto manuals search

<http://auto.somanuals.com>

TV manuals search

<http://tv.somanuals.com>