## MC-1000WU-20A High-Resolution B/W Camera User's Guide

Literature No. SOCU007 May 1998







#### **IMPORTANT NOTICE**

Texas Instruments and its subsidiaries (TI) reserve the right to make changes to their products or to discontinue any product or service without notice, and advise customers to obtain the latest version of relevant information to verify, before placing orders, that information being relied on is current and complete. All products are sold subject to the terms and conditions of sale supplied at the time of order acknowledgement, including those pertaining to warranty, patent infringement, and limitation of liability.

TI warrants performance of its semiconductor products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are utilized to the extent TI deems necessary to support this warranty. Specific testing of all parameters of each device is not necessarily performed, except those mandated by government requirements.

CERTAIN APPLICATIONS USING SEMICONDUCTOR PRODUCTS MAY INVOLVE POTENTIAL RISKS OF DEATH, PERSONAL INJURY, OR SEVERE PROPERTY OR ENVIRONMENTAL DAMAGE ("CRITICAL APPLICATIONS"). TI SEMICONDUCTOR PRODUCTS ARE NOT DESIGNED, AUTHORIZED, OR WARRANTED TO BE SUITABLE FOR USE IN LIFE-SUPPORT DEVICES OR SYSTEMS OR OTHER CRITICAL APPLICATIONS. INCLUSION OF TI PRODUCTS IN SUCH APPLICATIONS IS UNDERSTOOD TO BE FULLY AT THE CUSTOMER'S RISK.

In order to minimize risks associated with the customer's applications, adequate design and operating safeguards must be provided by the customer to minimize inherent or procedural hazards.

TI assumes no liability for applications assistance or customer product design. TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right of TI covering or relating to any combination, machine, or process in which such semiconductor products or services might be or are used. TI's publication of information regarding any third party's products or services does not constitute TI's approval, warranty or endorsement thereof.

Copyright © 1998, Texas Instruments Incorporated

### **Read This First**

#### About This Manual

This User's Guide provides installation, operation, and maintenance information for the MC-1000WU-20A black and white video camera.

#### How to Use This Manual

Thi	s document contains the following chapters:
	Chapter 1 – Introduction
	Chapter 2 – Specifications
	Chapter 3 – Installation
	Chapter 4 – Operation
	Chapter 5 – CCD Circuit Description
	Chapter 6 – Cleaning Instructions
	Appendix A – Functional Block Diagram
	Appendix B – Timing Diagrams
	fer to the appropriate chapter for more information or for instructions con ning procedures or practices.

#### Information About Cautions and Warnings

This book may contain cautions and warnings.

This is an example of a caution statement.

A caution statement describes a situation that could potentially damage your software or equipment.

This is an example of a warning statement.

A warning statement describes a situation that could potentially cause harm to <u>you</u>.

The information in a caution or a warning is provided for your protection. Please read each caution and warning carefully.

#### Trademarks

TI is a trademark of Texas Instruments Incorporated.

#### If You Need Assistance . . .

	Morld Wide Mob Cites		
I٦	World-Wide Web Sites		
1	TI Online	http://www.ti.cor	
	Semiconductor Product Information Center (PIC	n/sc/docs/pic/home.htm	
	North America, South America, C	entral America	
1	Product Information Center (PIC)	(972) 644-5580	
1	TI Literature Response Center U.S.A.	(800) 477-8924	
1	Software Registration/Upgrades	(214) 638-0333	Fax: (214) 638-7742
1	U.S.A. Factory Repair/Hardware Upgrades	(281) 274-2285	
	U.S. Technical Training Organization	(972) 644-5580	
Г	Europe, Middle East, Africa		
1	European Product Information Center (EPIC	) Hotlines:	
1	Multi-Language Support	+33 1 30 70 11 69	Fax: +33 1 30 70 10 32
1	Email: epic@ti.com		
1	Deutsch +49 8161 80 33 11 o	r +33 1 30 70 11 68	
1	English	+33 1 30 70 11 65	
1	Francais	+33 1 30 70 11 64	
1	Italiano	+33 1 30 70 11 67	
1	EPIC Modem BBS	+33 1 30 70 11 99	
1	European Factory Repair	+33 4 93 22 25 40	_
$\perp$	Europe Customer Training Helpline		Fax: +49 81 61 80 40 10
	Asia-Pacific		
	Literature Response Center	+852 2 956 7288	Fax: +852 2 956 2200
Г	Japan		
1	Product Information Center +0120-	81-0026 (in Japan)	Fax: +0120-81-0036 (in Japan)
	+03-3457-0972 or (IN	TL) 813-3457-0972	Fax: +03-3457-1259 or (INTL) 813-3457-1259
$\Box$	Documentation		
1	When making suggestions or reporting errors	in documentation. pl	ease include the following information that is on the title
1	page: the full title of the book, the publication		
1	Mail: Texas Instruments Incorporated	,	
1	Technical Documentation Services	s, MS 702	
1	P.O. Box 1443		
1	Houston, Texas 77251-1443		

**Note:** When calling a Literature Response Center to order documentation, please specify the literature number of the book.

## **Contents**

1	General Description         1-           1.1 Features         1-           1.2 Introduction         1-           1.3 Physical Description         1-           1.4 Equipment Supplied         1-           1.5 Equipment Required But Not Supplied         1-	-2 -3 -4 -5
2	Specifications2-2.1 Specifications2-2.2 Interface Circuit2-	-2
3	Installation         3-           3.1 Interface Assignments         3-           3.2 Installation Procedure         3-           3.2.1 Mounting the Camera         3-           3.2.2 Connecting an Auto-Iris Lens         3-           3.2.3 Connecting a Standard Lens         3-           3.2.4 Connecting the AC/DC Power Supply         3-           3.2.5 Connecting the Monitor         3-           3.3 Post-Installation Test         3-	-2 -4 -4 -4 -4
4	Operation         4-           4.1         General Operating Procedures         4-           4.1.1         Turn-On Procedure         4-           4.1.2         Turn-Off Procedure         4-           4.1.3         Focusing         4-           4.1.4         Adjusting Image Brightness         4-           4.2         External Operation (See Appendix B)         4-	-2 -2 -2 -2
5	CCD Circuit Description 5- 5.1 The CCD Array 5-	
6	Cleaning Instructions6-6.1 Cleaning6-	
Α	Functional Block Diagram       A-         A.1 Functional Block Diagram       A-	
В	Timing Diagrams B.1 Timing Diagrams B.	

## **Figures**

1–1	MC-1000WU-20A Interface Options and Mode Selection	1-3
2–1	Input Interface Circuit of VD, HD, and MCK	
2–2	Output Interface Circuit of Pixel and Shutter Monitor	
A-1	Functional Block Diagram	
B-1	TV Internal Mode (see Note)	
B-2	TV External Mode	
B-3	The Relationship of Vertical Sync Out and Mechanical Shutter or Strobe Light	B-3
B-4	The Relationship of Horizontal Drive Input and Video Output	
B-5	Shutter Internal Mode	
B-6	Shutter External Mode	B-5
B-7	The Relationship of VD Input and HD Input	B-5
B-8	HD Input Waveform	
B-9	The Relationship of VD Input and C-Sync	B-6
Tal	bles	
Tai		
2–1	Specifications	2-2
3–1	Auto Iris Connector Pin Assignment	
3–2	Power Connector Pin Assignment	
3–3	Video Connector (BNC Connector)	
3–4	AUX Connector Pin Assignment	

## Chapter 1

## **General Description**

This User's Guide describes installation, operation, and maintenance for the MC-1000WU-20A video camera.

Topic		Page	
1.1	Features		1-2
1.2	Introduction		1-3
1.3	Physical Description		1-4
	• • •		1-5
1.5	Equipment Required But Not Supplied		1-6
	1.1 1.2 1.3 1.4	1.1 Features 1.2 Introduction 1.3 Physical Description 1.4 Equipment Supplied	1.1 Features

#### 1.1 Features

The	Texas	Instruments	MC-1000WU-20A	camera	features	the	Texas
Instru	uments	TC215 solid-	state monochrome	charge-c	oupled-de	vice	(CCD)
image sensor. The camera is for vision system applications requiring high-							
resolution and high-sensitivity operation. The camera features include:							
		•					

TV frame rate, 15 Hz
High sensitivity, 0.35 lux typical
12 μm square pixel
TI-Virtual Phase CCD technology
High blue response
High near-IR response
Electron-hole recombination antiblooming
100% optical fill factor

1-2 General Description

#### 1.2 Introduction


The MC-1000WU-20A is one of a series of high-resolution video cameras that employs TI's mega-pixel CCD image sensors. The cameras are intended for scientific and industrial imaging applications where image data processing is required.

The MC-1000WU-20A camera employs the TI TC215 full-frame CCD image sensor, which features 1,017,000 active photosites, resulting in a very-high-resolution image. The TC215 sensor provides high sensitivity and good spectral response as a result of the TI patented Virtual Phase technology.

The TC215 sensor measures 17.2 mm diagonally and features 12-µm square pixels. The square pixels permit symmetrical image measurement in both the X and Y axis. The photosite has a 100% fill factor and is responsive to wavelengths in the ultraviolet through the visible and into the near-infrared spectral regions. The camera outputs composite analog video at a 20-mega-pixel per second data rate. Two operating options can be selected - a normal operating mode and a programmable shutter mode. In addition, the camera provides for auto-iris control.

A mechanical shutter or strobe light is recommended for most MC-1000WU-20A camera applications. The shutter operation is synchronized to the camera by supplying an external shutter command signal. The shutter may operate from a minimum integration time of 1/2500 second to 1/125 second or 10 frames/s maximum. Figure 1–1 shows the camera interface options and mode selection.

Figure 1-1. MC-1000WU-20A Interface Options and Mode Selection

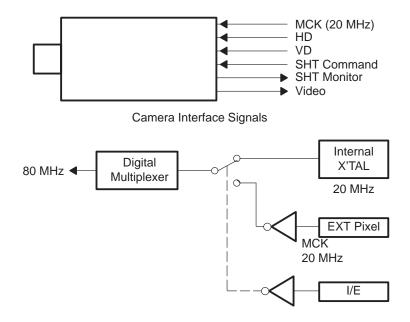

#### 1.3 Physical Description

The MC-1000WU-20A camera is housed in an aluminum case 210.6 mm long (excluding lens) by 68.0 mm high by 68.0 mm wide. It is self-contained except for power supply and monitor. The camera weighs 2.09 pounds.

The MC-1000WU-20A offers a standard TV C-mount lens attachment with an adjustable lens locking ring to allow precise adjustment of the lens back focal length. A variety of lenses or mechanical shutters may be used.

(??Page 3–4 says three ??)Two standard  $1/4 \times 20$  threaded tripod mounting holes on the baseplate allow secure mounting.

1-4 General Description

#### 1.4 Equipment Supplied

inv	ventory the shipment for the following items:			
	MC-1000WU-20A CCD camera			
	Lens (optional) (not supplied)(??If not supplied, it won't be in the inventory??)			
	MC-1000WU-20A CCD Camera User's Guide			
	Auto iris connector			
	Power connector (optional power supply)			
	I/O interface connector (not supplied)(??If not supplied, it won't be in the inventory??)			

After unpacking the camera and before discarding the packaging materials,

#### 1.5 Equipment Required But Not Supplied

The MC-1000WU-20A camera uses the full-frame TC215 CCD image sensor. This full-frame format sensor requires a mechanical shutter or an electronic light strobe to prevent image smear. The shutter or strobe light allows scene information to be captured during either the open time of the shutter or on-time of the strobe light. The transfer or read-out of the captured scene information is performed during the closed time of the shutter or off-time of the strobe. Once the shutter or strobe light is chosen, an appropriate lens may also be selected.

The MC-1000WU-20A camera supplies analog video at either a 15-Hz frame rate in the TV mode or a 10-Hz frame rate in the shutter mode and can be displayed directly to a video monitor capable of those frame rates. However, many applications require the addition of a custom or commercially available frame-buffer or other video processing equipment. This hardware will enable the user to capture and digitally process the scene information. The MC-1000WU-20A is presently supported by several manufacturers of video processing hardware and software systems. Most manufacturers have application notes available describing the interface required.

## Chapter 2

# **Specifications**

This chapter lists specifications for the MC-1000WU-20A camera and describes the interface circuit.

Topi	c Page
2.1	Specifications
2.2	Interface Circuit

#### 2.1 Specifications

Table 2–1 lists the specifications for the MC-1000WU-20A camera.

Table 2–1. Specifications

Item	Specification
Imager	Texas Instruments TC215 Full-Frame CCD
Resolution	1024(H)×1024(V) (total imager) 1000(H)×1017(V) (active pixels)
Pixel size	12 $\mu$ m $\times$ 12 $\mu$ m
Imager size	H: 12.2 mm V: 12.0 mm
Synchronization	Internal/external (jumper selectable)
TV mode Shutter mode	1050 lines/frame (33 blank lines) 15 frames/sec non-interlace 1050 lines/frame (33 blank lines)
Shaller mode	10 frames/sec (max)
Sensitivity	0.29 lux (max) 0.35 lux (typ) 0.41 lux (min) 1/30 integration Video output: 100 IRE S/N ratio: 48 dB Light source: T=2870°K
S/N ratio	48 dB
MTF	10 MHz chart, 35% (typ), 500 nm
White clip	0.90 ±0.05 V
Setup level	50 ±10 mV
Output dc level	0.30 ±0.05 V
Sync level	0.30 ±0.015 V
Supply voltage	+5 ±0.15 Vdc -12 ±0.4 Vdc +12 ±0.4 Vdc
Power consumption (typical)	+5 V at 0.820 A +12 V at 0.180 A -12 V at 0.150 A
Non-uniformities	Total black and white pixel non-uniformities, less than 20. Vertical line non-uniformities, less than 5.
Shading (maximum) Horizontal Vertical	10%     100%       15 mV     50 mV       20 mV     70 mV
Vertical frequency	15.46 Hz
Horizontal frequency	16.234 kHz
Gamma	1.0

2-2 Specifications

Table 2–1. Specifications (Continued)

Item	Specification
Operating temperature	–10°C to +45°C
Storage temperature	−30°C to +85°C
Dimensions	68 (W)×68 (H)×210.6 (D) mm
Weight	2.09 lbs

#### 2.2 Interface Circuit

The input interface circuit of VD, HD, and MCK shown in Figure 2–1, consists of one SN75124 input gate pulled up through a 4.7-k $\Omega$  resistor to 5 Vdc and pulled down to ground through an optional 100- $\Omega$  resistor. The optional pull down is selected by jumpers JP1 (MCK), JP2 (HD), and JP3 (VD).

Figure 2-1. Input Interface Circuit of VD, HD, and MCK


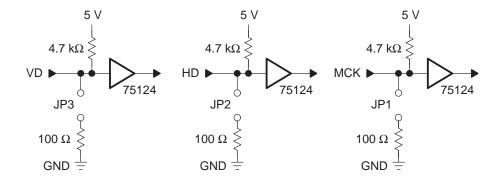


Figure 2-2. Output Interface Circuit of Pixel and Shutter Monitor



NOTE A. For pixel clock receiving, pull domain resistor 100  $\Omega$  is recommended.

2-4 Specifications

## Chapter 3

## Installation

This chapter describes interface assignments and gives instructions for installing and testing the camera.

Topic			е
	3.1	Interface Assignments 3-2	2
	3.2	Installation Procedure 3-4	1
	3.3	Post-Installation Test	5

#### 3.1 Interface Assignments

Depending upon the application, it may be necessary to build a camera cable that contains some combination of the signals listed below:

Table 3-1. Auto Iris Connector Pin Assignment

Pin Number	Signal Name
A	Video signal
В	GND
С	+12 V
D	NC
E	NC

**Note: Connectors** 

Camera side: PRC05-R5M (Tagimi) Cable side: PRC05-P5F (Tagimi)

Table 3–2. Power Connector Pin Assignment

Pin Number	Signal Name
A	+12 V
В	+12 V
С	GND
D	+5 V
E	+5 V
F	GND
G	–12 V
Н	GND

Note: Connectors

Camera side: R03-R8F (Tagimi) Cable side: R03-PB8M (Tagimi)

Table 3–3. Video Connector (BNC Connector)

Pin	Signal Name	
Center pin	Composite video	
Shell	Video RTN	

3-2 Installation

Table 3-4. AUX Connector Pin Assignment

Pin	Signal Name	I/O	Trigger	Interface
1	MCK RTN			
2	Horizontal Drive RTN			
3	Vertical Drive RTN			
4	Pixel Clk Out RTN			
5	Shutter RTN			
6	Shutter Monitor RTN			
7	Internal/External RTN			
8	GND			
9	MCK IN	1		SN75124N
10	Horizontal Drive	1	Negative	SN75124N
11	Vertical Drive	I	Negative	SN75124N
12	Pixel Clk Out	0		SN75123N
13	Shutter CMD	I		SN74LS14N
14	Shutter Monitor OUT	0	Negative	SN75123N
15	Internal/External	1		

#### **Note: Connector Information**

External mode: short 7 pin——15 pin Internal mode: open 7 pin——15 pin

Connectors: Dsub 15 pin female connector, #4-40 (cable side)

#### 3.2 Installation Procedure

The following paragraphs describe installation procedures for the MC-1000WU-20A camera.

#### 3.2.1 Mounting the Camera

The camera can be mounted using any one of (??Two on page 1–4??) three  $1/4 \times 20$ -thread mounting holes located on the camera base plate.

#### 3.2.2 Connecting an Auto-Iris Lens

Most auto-iris lenses can be used with MC-1000 series cameras. Connect the auto-iris lens to the MC-1000WU-20A camera per the auto-iris connector pinout table in Section 3.1 and the lens wiring schematic provided by the lens manufacturer.

#### 3.2.3 Connecting a Standard Lens

A number of standard C-mount or shutter attachments may be used with the camera. The camera employs a lens locking ring to fix the minimum distance between the rear lens element and the CCD imager.

#### 3.2.4 Connecting the AC/DC Power Supply

The PS-1000 power supply is recommended for use with the camera, because it already has the proper power connector installed. A bench supply can also be used, provided that the bench supply output meets the power requirements of the camera listed in Chapter 2.

#### 3.2.5 Connecting the Monitor

Video may be viewed directly from the camera by attaching a video cable to the video input jack of a TV monitor. The monitor must be capable of 15 Hz vertical synchronization. The video may also be the input source to commercially available frame-buffer or other video processing hardware. The video signal should be properly terminated into a 75-ohm load. A mechanical shutter or strobe light will be required in most applications.

3-4 Installation

#### 3.3 Post-Installation Test

When the power and monitor connections have been made, test the camera by applying power to the monitor and the external power supply (if used). The green power-on LED on the camera rear panel should light and an image should appear on the display. It may be necessary to operate the shutter control or frame-buffer hardware to obtain an image. In addition, the lens may require focus adjustment to obtain a sharp picture.

3-6 Installation

## Chapter 4

## **Operation**

This chapter describes general and external operating procedures for the MC-1000WU-20A camera.

Topic	Pag	е
4.1	General Operating Procedures 4-2	2
4.2	External Operation (See Appendix B) 4-3	3

#### 4.1 General Operating Procedures

The MC-1000WU-20A camera features high-resolution, stable, very sensitive, linear images from an array of 1000(H) by 1017(V) picture elements. The camera operates as one unit of a user-defined imaging system. Other components typically consist of a mechanical shutter or strobe light, a TV frame-buffer or frame-storage computer or hardware system, an optical system (lens), and a power supply. The MC-1000WU-20A camera operates with little or no operator adjustment after the initial setup period. The following paragraphs give operating procedures for the camera.

#### 4.1.1 Turn-On Procedure

The camera does not have a power switch; as soon as power is applied by the power supply, the camera becomes operable. The green LED on the rear panel signals that power is applied to the camera. After connection of the power supply, a picture should appear on a monitor screen within a few seconds. If additional frame-buffer hardware is used in the application, verify that the hardware is working properly.

#### 4.1.2 Turn-Off Procedure

To turn off the camera, remove the power connector from the camera, or switch off the appropriate system power supply.

#### 4.1.3 Focusing

The MC-1000 series cameras use a lens-locking ring to set the minimum distance between the rear lens element and the CCD imager. Focus the lens by rotating the front lens barrel clockwise or counterclockwise until the image is sharp. If a sharp image cannot be obtained, do the following steps:

- 1) Check lens surface for smears, smudges, or dust. Clean lens surface per lens manufacturer's instructions.
- Check glass cover on CCD imager for smears, smudges, or dust. Clean glass cover with alcohol and a cotton swab. See Chapter 6, Maintenance Instructions, for details.
- 3) Check the distance between the rear lens element and the CCD imager. If necessary, adjust the distance by loosening the lens-locking ring. Remember to tighten the lens-locking ring after adjusting to fix the new distance setting.

#### 4.1.4 Adjusting Image Brightness

Image brightness is a function of exposure time (which is fixed in standard TV applications) and lens aperture (F number). The sensitivity of the CCD sensor and the amount of light reaching the sensor through the optical system is a function of scene illumination, optical alignment, and magnification. In most cases, the image brightness can be adjusted by varying the lens aperture. If an image is too dark, rotate the lens aperture ring to a smaller number. This selects a larger lens aperture, allowing more light through the lens.

4-2 Operation

#### 4.2 External Operation (See Appendix B)

Figure B–1. TV Internal Mode
Figure B–2. TV External Mode
Figure B–3. The Relationship of Vertical Sync Out and Mechanical Shutter or Strobe Light.
Figure B-4. The Relationship of Horizontal Drive Input and Video Output
Figure B–5. Shutter Internal Mode
Figure B–6. Shutter External Mode
Figure B-7. The Relationship of VD Input and HD Input
Figure B–8. HD Input Waveforms
Figure B–9. The Relationship of VD Input and C-Sync

4-4 Operation

### **Chapter 5**

## **CCD Circuit Description**

This chapter describes the TC215 CCD image sensor circuit used in the camera.

Topi	c	Page
5.1	The CCD Array	5-2

#### 5.1 The CCD Array

The TC215 is a full-frame charge-coupled device (CCD) image sensor that provides very-high-resolution image acquisition for image processing applications such as robotics vision, medical x-ray analysis, and metrology.

The image format of the sensor measures 12.0 mm horizontally by 12.2 mm vertically; the image area diagonal is 17.2 mm. The image area contains 1017 active lines with 1000 active pixels per line. Six additional dark reference lines give a total of 1024 lines in the image area, and twenty-four additional dark reference pixels per line give a total of 1024 pixels per horizontal line. The pixels are 12 mm square and form precise rows and columns, horizontally and vertically, allowing precise image geometry measurements.

The CCD is a solid-state device, which requires no external adjustment or regular maintenance. Unlike a conventional pickup tube, there are no electromagnetic alignment routines to be observed because there is no electron beam involved.

The full-frame image sensor should be used with a shutter or with strobed illumination to prevent smearing of the image during readout. After image capture (integration time), the readout is accomplished by transferring the charge one line at a time into two serial registers, each of which contains 512 data elements and 12 dummy elements. The typical pixel rate is 20 mega-pixels per second using both serial registers. Operating the TC215 at the typical data rate of one field per frame generates video at a continuous 15 frames per second in the TV mode of operation.

## Chapter 6

# **Cleaning Instructions**

This chapter gives instructions for cleaning the camera.

Topic		Page
6.1	Cleaning	6-2

#### 6.1 Cleaning

The camera body, lens, and the CCD imager optical glass window should be kept clean and free of dust and grime. Keeping the lens and the CCD imager window clean enhances the picture, ensuring better results in the camera application. These surfaces can be cleaned with denatured alcohol and a cotton swab. Extreme care should be taken when cleaning the optical glass CCD imager window to avoid breaking the glass.

6-2 Cleaning Instructions

### Appendix A

# **Functional Block Diagram**


This appendix contains the functional block diagram for the camera.

Topic		Page
A.1	Functional Block Diagram	 A-2

A-1

#### A.1 Functional Block Diagram

Figure A-1. Functional Block Diagram

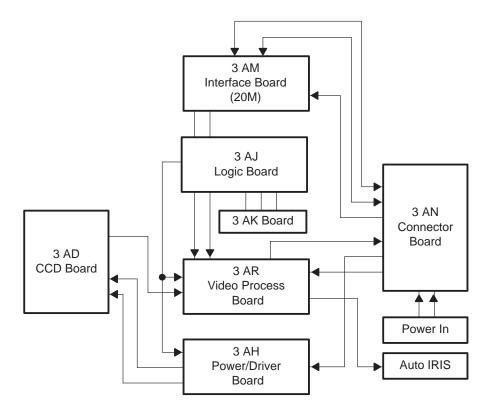

## Appendix B

# **Timing Diagrams**


This appendix contains timing diagrams for the camera.

Торіс		
B.1	Timing Diagrams	B-2

B-1

#### **B.1 Timing Diagrams**

Figure B-1. TV Internal Mode (see Note)

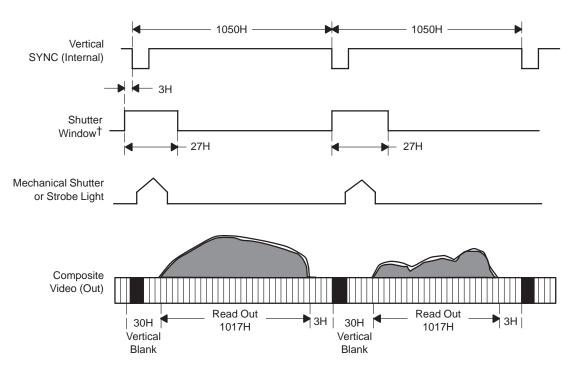

<sup>&</sup>lt;sup>†</sup> No output. This timing indicates CCD state which can be the integration. Shutter or strobe timing have to be synchronized with this window period.

Note: This mode is used for camera operation verification.

Figure B-2.TV External Mode

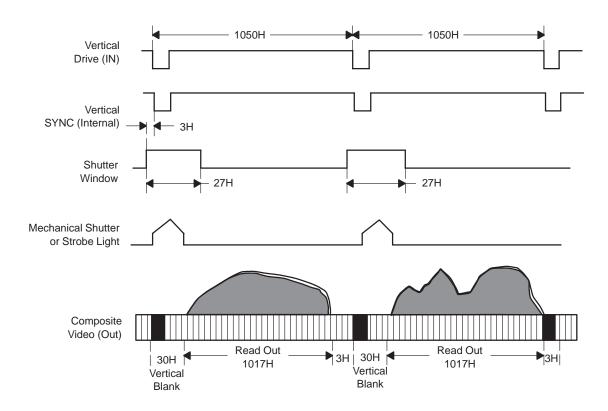


Figure B-3. The Relationship of Vertical Sync Out and Mechanical Shutter or Strobe Light

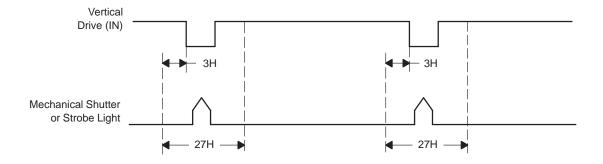


Figure B-4. The Relationship of Horizontal Drive Input and Video Output


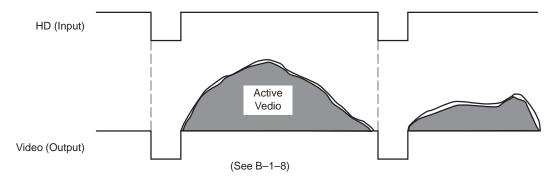


Figure B-5. Shutter Internal Mode

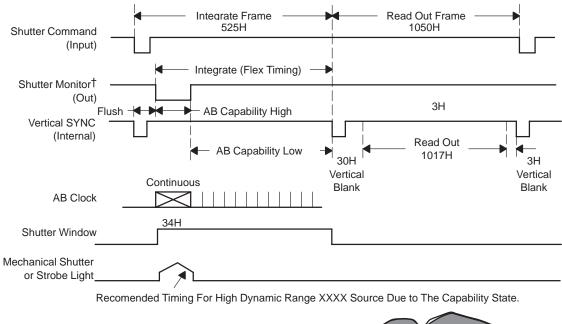

Composite Video (Out)

Read Out 1017H

Vertical Blank

Read Out 1017H

Read Out 1017H

Read Out 1017H

Read Out 1017H

<sup>†</sup> Fall edge shows starting of CCD integration state. Rise edge shows AB capability state change. The integrate time does not change, but changes AB capability.

Figure B-6. Shutter External Mode

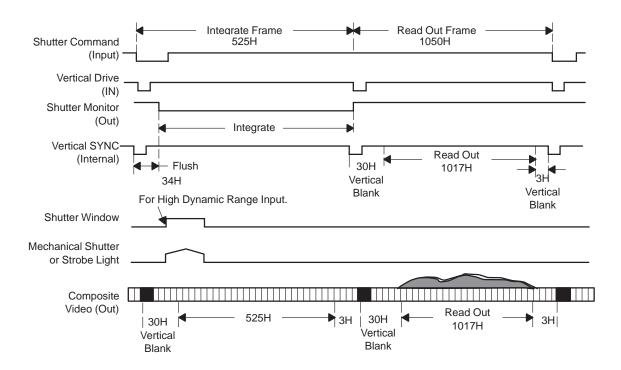


Figure B-7. The Relationship of VD Input and HD Input

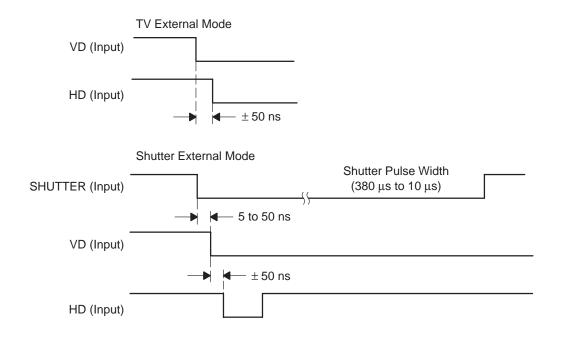


Figure B-8. HD Input Waveform





Figure B–9. The Relationship of VD Input and C-Sync



#### **IMPORTANT NOTICE**

Texas Instruments and its subsidiaries (TI) reserve the right to make changes to their products or to discontinue any product or service without notice, and advise customers to obtain the latest version of relevant information to verify, before placing orders, that information being relied on is current and complete. All products are sold subject to the terms and conditions of sale supplied at the time of order acknowledgement, including those pertaining to warranty, patent infringement, and limitation of liability.

TI warrants performance of its semiconductor products to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are utilized to the extent TI deems necessary to support this warranty. Specific testing of all parameters of each device is not necessarily performed, except those mandated by government requirements.

CERTAIN APPLICATIONS USING SEMICONDUCTOR PRODUCTS MAY INVOLVE POTENTIAL RISKS OF DEATH, PERSONAL INJURY, OR SEVERE PROPERTY OR ENVIRONMENTAL DAMAGE ("CRITICAL APPLICATIONS"). TI SEMICONDUCTOR PRODUCTS ARE NOT DESIGNED, AUTHORIZED, OR WARRANTED TO BE SUITABLE FOR USE IN LIFE-SUPPORT DEVICES OR SYSTEMS OR OTHER CRITICAL APPLICATIONS. INCLUSION OF TI PRODUCTS IN SUCH APPLICATIONS IS UNDERSTOOD TO BE FULLY AT THE CUSTOMER'S RISK.

In order to minimize risks associated with the customer's applications, adequate design and operating safeguards must be provided by the customer to minimize inherent or procedural hazards.

TI assumes no liability for applications assistance or customer product design. TI does not warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right of TI covering or relating to any combination, machine, or process in which such semiconductor products or services might be or are used. TI's publication of information regarding any third party's products or services does not constitute TI's approval, warranty or endorsement thereof.

Copyright © 1998, Texas Instruments Incorporated

Free Manuals Download Website

http://myh66.com

http://usermanuals.us

http://www.somanuals.com

http://www.4manuals.cc

http://www.manual-lib.com

http://www.404manual.com

http://www.luxmanual.com

http://aubethermostatmanual.com

Golf course search by state

http://golfingnear.com

Email search by domain

http://emailbydomain.com

Auto manuals search

http://auto.somanuals.com

TV manuals search

http://tv.somanuals.com